
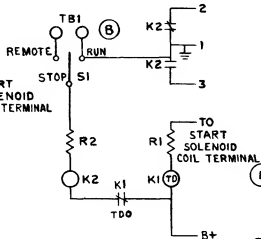


625B1024

WIRING DIAGRAM REAR VIEW OF COVER

SCHEMATIC

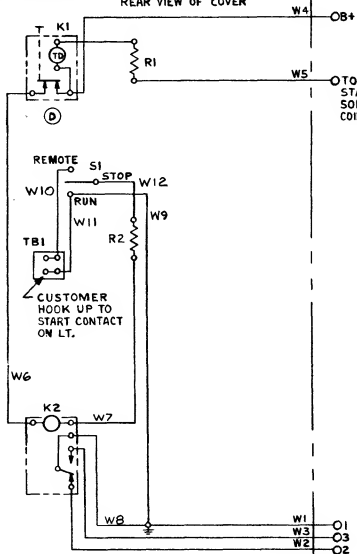

PARTS LIST			QTY	DESCRIPTION
REF	DES.	PART NO.		
K1		320B104	1	RELAY-CRANKING LIMITER
K2		307B1052	1	RELAY-START, STOP
		304-580	2	INSULATOR
R1		304A192	1	RESISTOR, 3 Ω , 10 W
R2		304A251	1	RESISTOR, 30 Ω , 5 W
S1		308-138	1	SWITCH-SELECTOR
TB1		332A609	1	BLOCK-TERMINAL
		332A1003	1	STRIP-MARKER
W1-W5		338A551	1	LEAD ASSY, 32" LG
		301C3265	1	COVER-ADAPTER KIT
		301B3266	1	ADAPTER KIT BOX
		98A2248	1	SILKSCREEN
W6		336A4358	1	LEAD
W7		226A1863	1	LEAD
W8		336A4356	1	LEAD
W9		336A4357	1	LEAD
W10,11		336A4355	2	LEAD
W12		226A1861	1	LEAD

FOR THESE AC
MODELS ONLY, AT
ALL VOLTAGES

2.5 AJ-

7.5 JB-

NH-

15.0 JC-

REQUIRED M16 BRKTS
TO BE ORDERED
SEPARATELY

301C1870

301B3288

301A3285, 301B3289

MOUNT ON COVER
OF OUTPUT BOX

C

625B1024

F ADDED W6-12	1/15-25-78
E WAS 332-1178	3/15-25-78
D REV KI CONTACT WIRING	5/15-11-73
C REMOVED NB MODEL	6/12-11-70
B CORRECTED S1 IN SCHEM	6/10-30-70
A GENERAL REVISIONS	6/12-26-70

REVISION
DATE
BY
CHK
DATE

ONAN DIVISION OF STUDEBAKER CORPORATION
Muskegon, Michigan

MODEL NO	DATE	BY	CHK	DATE
300-737	1-14-70	CDR	6.H.T.	
NAME	WIRING DIAGRAM CONTROL-ADAPTER KIT			
CONVERT 3 TO 2 WIRE START	DWG NO.	625B1024		